



Dimensional Drawing

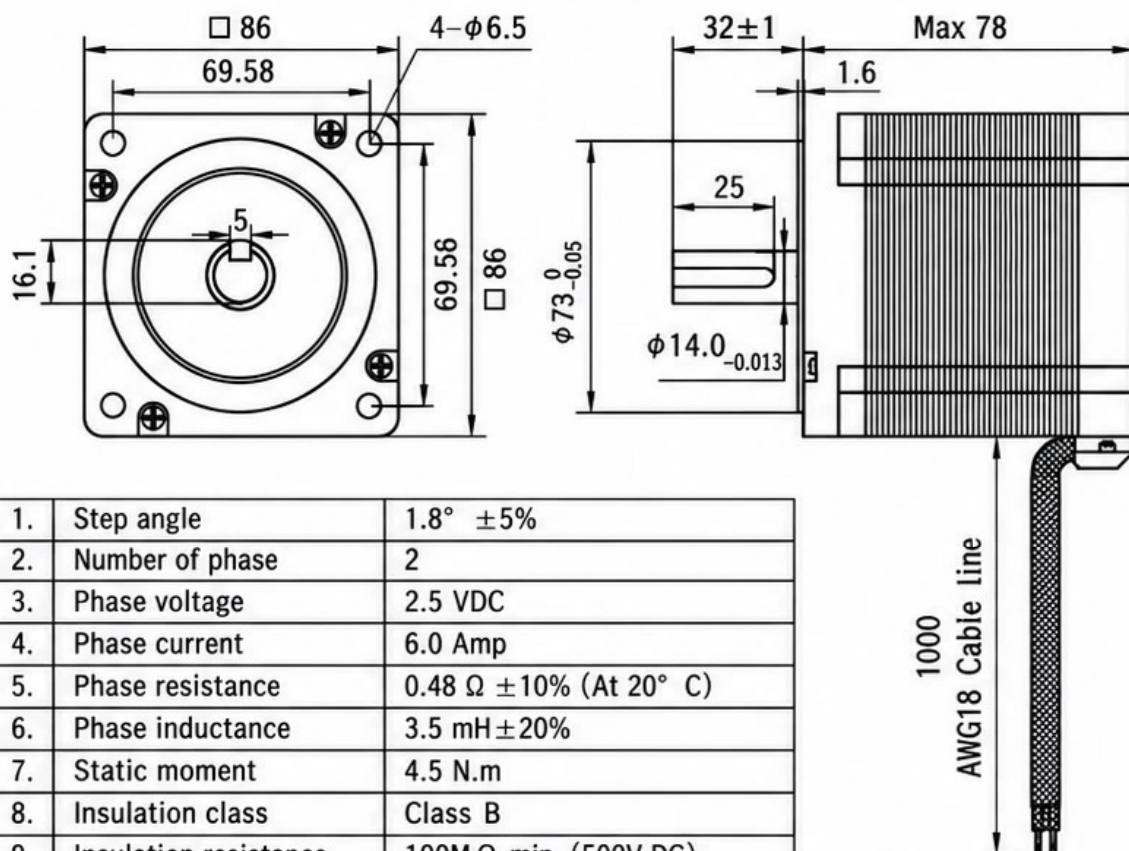

Wiring Diagram

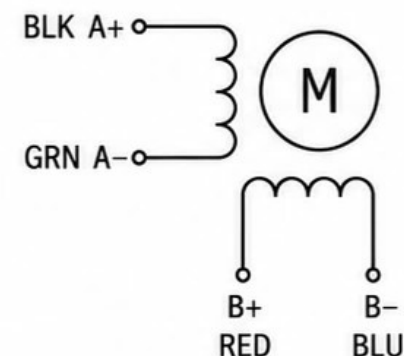

1.	Step angle	1.8° $\pm$ 5%
2.	Number of phase	2
3.	Phase voltage	2.5 VDC
4.	Phase current	6.0 Amp
5.	Phase resistance	0.48 Ω $\pm$ 10% (At 20° C)
6.	Phase inductance	3.5 mH $\pm$ 20%
7.	Static moment	4.5 N.m
8.	Insulation class	Class B
9.	Insulation resistance	100M Ω min. (500V DC)
10.	Ambient temperature	-20° ~ +50°
11.	Ambient humidity	15% to 95%
12.	Motor weight	Approx 2.3 Kg
13.	Use voltage	VDC: 24-110V VAC: 24-72V
14.	Recommended drive	OK2D872

Excitation sequence and direction of clockwise

STEP	A+	B+	A-	B-
1	+	+	-	-
2	-	+	+	-
3	-	-	+	+
4	+	-	-	+

seen from the mounting surface it is clockwise

Technology

Unit

mm

OUKEDA®

Drawing

OK86DL78-604A-32J-C1

Design

Check

Approved

HE ZHEN

Scale

1: 1