



Dimensional drawing

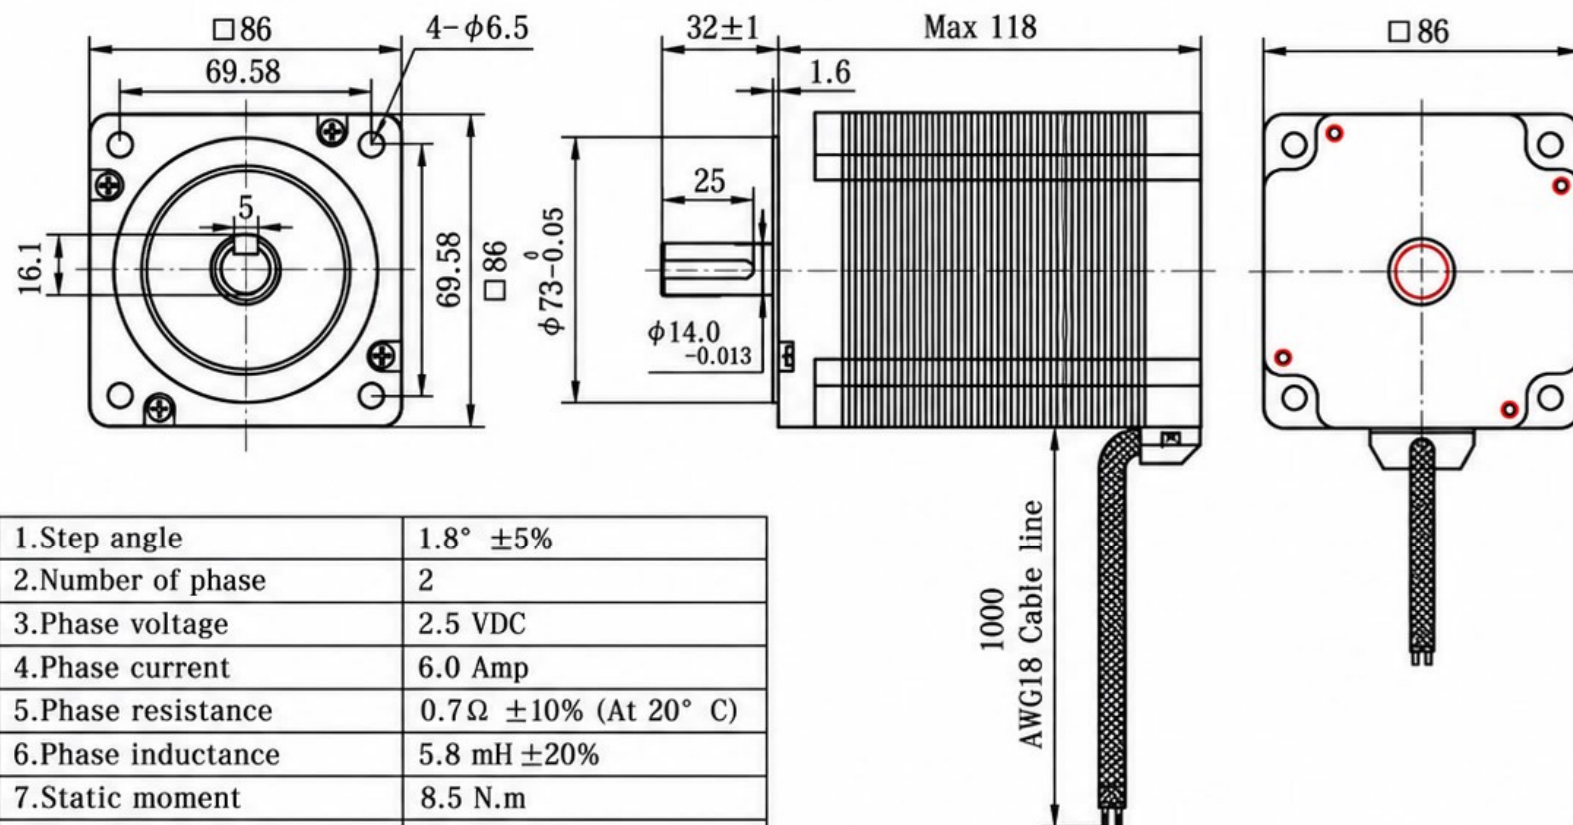

Wiring Diagram

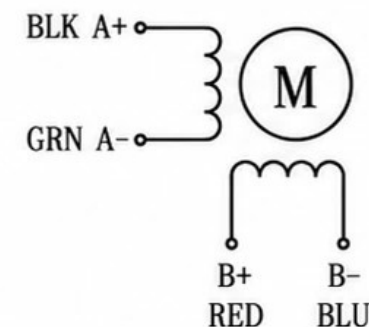

1.Step angle	1.8° ±5%
2.Number of phase	2
3.Phase voltage	2.5 VDC
4.Phase current	6.0 Amp
5.Phase resistance	0.7Ω ±10% (At 20° C)
6.Phase inductance	5.8 mH ±20%
7.Static moment	8.5 N.m
8.Insulation class	Class B
9.Insulation resistance	100MΩ min. (500V DC)
10.Ambient temperature	-20° ~+50°
11.Ambient hum	15% to 95%
12.Motor weight	Approx 3.8 Kg
13.Use voltage	VDC:24-110V VAC:24-72V
14.Recommended drive	OK2D872

Excitation sequence and direction of clockwise

STEP	A+	B+	A-	B-
1	+	+	-	-
2	-	+	-	+
3	-	-	+	+
4	+	-	+	-

seen from the mounting surface It 1sclockwise

Technology		Unit	mm	OUKEDA [®]	Drawing	OK86DL118-604A-32J-C1
Design						
Check						
Approved	HE ZHEN	Scale	1: 1			